

Bill of Materials


<p>47R 100R x 3 1K x 3 1K5 x 2 1K8 x 1 4K7 x 1 5K6 x 1 10K x 3 15K x 2 22K x 2 33K x 2 47K x 4 68K x 1 100K x 8 150K x 1 270K x 1 1M x 1</p> <p>All resistors ¼ watt metal film</p>	<p>470pF x 2 1uF x 3 (non polarised) 10uF x 1 22uF electrolytic x 2 47uF electrolytic x 2</p>	<p>TL072 x 3 LM13700 x 1 BC547 x 1 BC557 x 1 1N4148 x 2</p> <p>8 pin socket x 3 16 pin socket x 1</p> <p>State 700 PCB set State 700 panel</p>	<p>A100K x 3 (or these)*</p> <p>B100K x 3 (or these)*</p> <p>A100K x 1</p> <p>B100K x 1</p> <p>10K trimmer x 1 100K trimmer x 1</p> <p>3.5mm socket x 9</p> <p>Male 40 pin header Female 40 pin header</p> <p>Box header Knob x 2</p>
---	---	--	---

* I prefer the Song Huei tall trimmers because they have a longer shaft and a white notch.



Main PCB assembly

1. Solder all resistors.
2. Solder all IC sockets
3. Solder both 470pF capacitors
4. Solder both transistors
5. Solder all electrolytic capacitors and 3 x 1uF capacitors
6. Solder the power header – if you're using box type, observe correct polarity
7. Cut male headers to size and solder them into place. Make sure that they stick out of the bottom of the PCB.

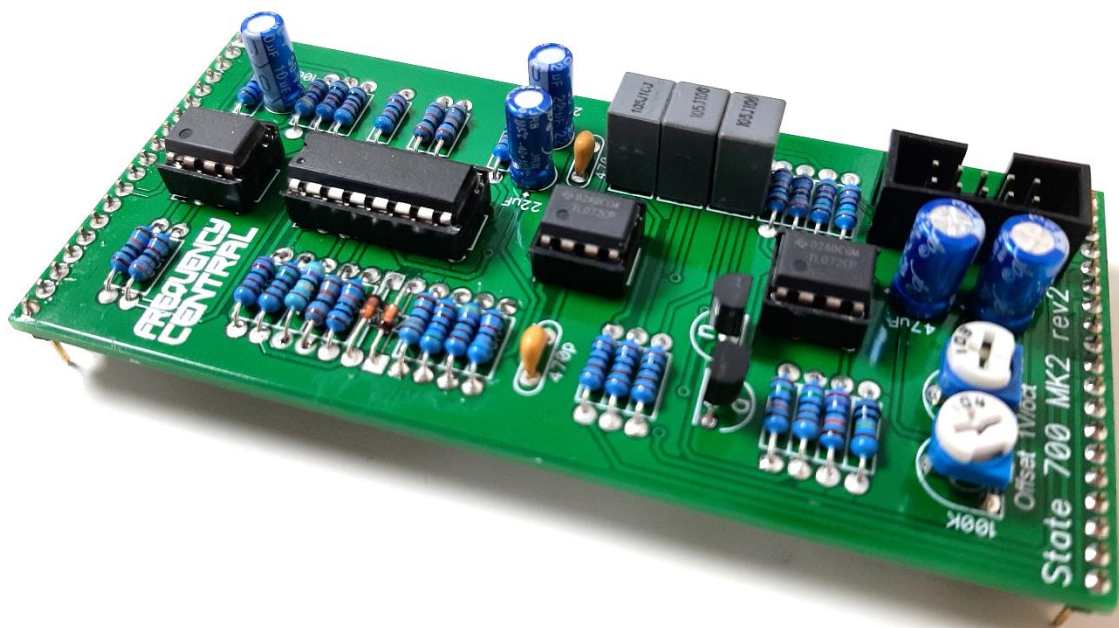

Pots 'n' sockets PCB

1. Solder all resistors
2. Place all sockets on the PCB, making sure the ground tabs line up with the PCB's ground pads, then place the panel over them. This will assure that the sockets are correctly positioned. Flip the whole lot over and solder the sockets into place.
3. Place all pots on the PCB, and fold over their mounting tabs at the rear of the PCB, then place the panel over them. This will assure that they are correctly positioned. Flip the whole lot over and solder the pots into place.
4. Cut female headers to size and solder them into place. Make sure that they stick out of the bottom of the PCB.



Note: Not all pots and sockets are equal in height. Providing you use the ones in the links provided, everything will line up perfectly.

Make sure that you plug the **Main PCB** into the **Pots 'n' sockets PCB** the right way around – Frequency Central logo should be the right way up.

Calibration

1. **V/Oct trimmer:** turn Resonance all the way to self oscillation. Patch a 1V/oct source into CV input 1, with the attenuator fully clockwise. Play octaves and adjust the V/Oct trimmer until they are spot on.
2. **Offset trimmer:** you want to tweak this so that the filter is fully open when the Cutoff pot is fully clockwise.

RDH 21/01/19

<http://www.frequencycentral.co.uk/>